



# Service Bulletin

File in Section: -

Bulletin No.: PIT5349

Date: November, 2014

## PRELIMINARY INFORMATION

**Subject:** Informational - MagneRide Rear Shocks Not Interchangeable Left To Right  
(Production Only)

**Models:** 2015 Chevrolet Silverado High Country  
2015 GMC Sierra Denali  
With MagneRide Magnetic Ride Control (RPO Z95)

This is an informational PI to advise that the production rear shocks on trucks equipped with MagneRide (RPO Z95) are not interchangeable left to right. When performing any service that requires the rear shocks to be removed, their location needs to be noted so that they can be reinstalled in their original locations. If the shocks are swapped left to right, it could cause a harsh ride, shock bottoming out, metal to metal noise, rattle, and/or damage to the shocks.

**Note:** If the rear shocks need to be replaced for any reason, the "service" replacement shocks can be installed on either the left or right sides. Only the "production" shocks are not interchangeable left to right.